

Play Area Repairs, Maintenance and Replacement

The Estates Committee considered proposal for authorising the costs of play equipment supplies and remedial works arising from play inspections (WPC.EC.24.02.04) at its meeting on 1st February 2024 (Min. 24.02.09 refers). No amendments to the proposal were identified, but noting that the combined costs of the current and next financial year exceeded £3000, the meeting asked the clerk to refer the proposal to the parish council for consideration.

A summary of findings from the most recent West Suffolk Play Area inspections is attached as **Appendix A**.

The clerk also met with the inspector on the 7th February, and established that:

- In his view, the basket seat itself did not require replacement in the short to medium term
- The tree canopy should be trimmed back such that it is at least 2m from any play equipment at height

Following the October inspection, the clerk had sought costs for all replacement items such as chains, shackles, bushes, swing seats, bolt caps etc. and the quote received, from Online Playgrounds is attached as **Appendix B**. A further quote has now been received from GB Sports Limited (**Appendix C**) A summary setting out a proposed timescale of work is attached as **Appendix D**, identifying items for replacement and maintenance over the current and next financial years, to be included in the draft budget for 2025-26 and as part of any future grant application.

In February '23, the Committee authorised the costs of play equipment supplies (**WPC.EC.23.02.03**) as below:

The Estates Committee authorise the clerk to purchase replacement equipment (including where necessary, the cost of fitting replacements) as identified under the monthly inspections undertaken in accordance with the service level agreement (low risk or greater) with West Suffolk Council during the financial year 2023/24 up to: (current spend shown in brackets)

- | | | | |
|------|--------------------------|-------------------|--------------------|
| i. | Playground Cemetery Road | £1000.00 plus VAT | (£506.77 plus VAT) |
| ii. | Playground Bury Road | £500.00 plus VAT | |
| iii. | MUGA & Skate Park | £500.00 plus VAT | (490.00 plus VAT) |

Leaving the following funds available for maintenance until year end:

- | | | |
|------|--------------------------|------------------|
| i. | Playground Cemetery Road | £493.23 plus VAT |
| ii. | Playground Bury Road | £500.00 plus VAT |
| iii. | MUGA & Skate Park | £ 10.00 plus VAT |

Additionally, Online Playgrounds have issued a credit note (£100 plus VAT) to the parish council against an item of work in the previous financial year.

Work which the parish council could undertake as part of volunteer days includes:

- Repair of paling fence to Childrens Play Area at Cemetery Road and removal of concrete block
- Cleaning down of wood and metal play equipment at Cemetery Road and treatment for wood and metal
- Replacement of bin in MUGA space (there is one spare in the Chapel of Rest)

And the clerk has approached and obtained from the WI consent to access their water supply.

Hilary Workman
Clerk & RFO
February 2024

WPC.24.02.09 – Play Area Maintenance

The clerk has split the quotes into 4 sections – spend from the current and next financial year, 2025/6, and purchases to be made if grant funding approved, as the total cost is beyond the parish council in any one year. Work to be completed in 2025-26 and any items to be purchased through grant funding, the clerk would seek additional and subsequent quotes for.

Thus, the proposal is to purchase consumable items in the current financial year (applying the credit note), and then purchase the remaining consumables and instruct the work in the next financial year (Online playgrounds have confirmed that they would be amenable to this approach). Replacement of the uprights for the bay swing seats at Bury Road would be budgeted for in 2025/26, and the replacement springers for cemetery road and basket seat would be included in any grant applications which become available.

Thus, the planned spend would look like this:

	Bury Road	Cemetery Road	Skate Park	Total
Current FY	£270.90	£348.00	£10.00	£628.90
Next FY	£420.00	£1,538.00	£41.25	£1,999.25
2025/26	£1,565.20	£2,390.80		£3,956.00
Grant Application		£3,826.00		£3,826.00
Totals	£2,256.10	£8,102.80	£51.25	£10,410.15

All prices ex VAT.

This would be more expensive, because the suppliers would charge separately to come back in 2025/26 for replacement uprights. As the total cost for the current FY and work to be completed in the next FY is originally anticipated to be over £3,000.00, in accordance with the Scheme of Delegation, approval for the overall scheme was referred to the parish council.

The relevant council powers are:

- Public Health Act 1875, s.164
 - Power to provide and maintain land for public recreation -
 - Power to provide and manage recreation grounds, public walks, pleasure grounds and open spaces
- Local Government Act 1972, s.111 - Power to do anything that will facilitate, be conducive to or incidental to the discharge of its powers and functions.

The following reserves are available to fund this:

	Current FY	2024 – 25	Earmarked Reserves – Playground and Teen Project Maintenance
Bury Road Play Area	£493.23	£1000.00	£1650.00
Cemetery Road Play Area (incl. Zip Wire)	£500.00	£1500.00	
MUGA & Skate Park	£ 10.00	£500.00	
Total	£1003.23	£3000.00	£1650.00

This approach would require either transferring between revenue budget lines in the next FY, or drawing down some earmarked reserves, both of which would require a decision by the parish council.

WPC.24.02.09 – Play Area Maintenance

At its September meeting, the Estates Committee:

considered a draft proposal for future works to Six Acres, Cemetery Road play area, the Multi-Use Games Area, Skate-park and cable way, and Bury Road pocket park (previously circulated as WPC.EC.22.09.03), which could form the basis of grant applications for funding as they are published and asked the clerk to develop a template grant application on the basis of the works identified in the report (Min. EC.23.09.09).

At its September meeting, the parish council noted:

A proposal by the Estates Committee to develop an outline bid for Six Acres & play area improvements for grant funding (note report WPC.EC.23.09.04) and asked the clerk to develop a template grant application and plan for community engagement activities to gather evidence in support of all the elements. (Min. 23.09.16 refers)

A number of items identified in the proposed timescale for work at Appendix D could be included in this grant application, and a more detailed proposal ~~will~~ be brought back to the April meeting.

Stanton Parish council are in the process of arranging play area inspection training, at an anticipated cost of £250 per person (including certification) and the clerk has expressed an interest in one place (there is currently a revenue budget of £756 for training).

GB Sports Limited have also advised that they provide some maintenance courses where the repair work is undertaken as part of the course, and materials (if not already purchased) would be invoiced after the course.

Actions

Items identified in the proposal (Appendix D) be included in

- a. the draft budget prepared for the financial year 2025-26; and**
- b. the draft proposal for future works to parish amenity spaces**

Recommendation

The parish council:

- i. authorise the cost of inspection and/or maintenance training for up to two councillors at a cost of not more than £500.**
- ii. The Estates Committee authorise the clerk to purchase replacement equipment (including where necessary, the cost of fitting replacements) as identified under the monthly inspections undertaken in accordance with the service level agreement (low risk or greater) with West Suffolk Council during the financial year 2024/25 up to:**
 - a. Playground Cemetery Road (including Zip wire) £1500.00 plus VAT**
 - b. Playground Bury Road £1000.00 plus VAT**
 - c. MUGA & Skate Park £ 500.00 plus VAT**
- iii. Authorise the clerk to prepare purchase order(s) for purchase of replacement materials and works to play equipment at Cemetery Road, Bury Road and the Zip Wire for the items identified at Appendix D for the current and next financial years year, at a cost of not more than £3000.00 plus VAT, supplier(s) to be determined by clerk based on value for money at time of order.**



Wickhambrook. Bury Road

Inspection Ref: 2286216

Site Ref: 33809

Operational Inspection - 7-February-2024 - 08:39 Inspector Philip Smith

Risk Assessment: 8 Low Risk

**Location:**

The site is located in an area of public open space and is overlooked by a number of properties in the local community.

Disabled Access:

Some accessible features; an area that presents difficulties to the majority of people with disabilities but in favourable circumstances and certainly in partnership can be accessed.

i 4 - Very Low Risk

Item: Site General
Manufacturer: Owner/Operator
Surface Type: N/A
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 4 - Very Low Risk

Item: Sign
Manufacturer: Owner/Operator
Surface Type: N/A
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 8 - Low Risk

Item: Gate - Self Closing
Manufacturer: Not Identified
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 2

Finding 1

The gate is closing too quickly (less than 4 seconds) - Take corrective action to ensure that the gate closes in 4-8 seconds

Finding 2

There is some damage to the item and is slightly out of alignment - Monitor for any further deterioration and repair as required

i 6 - Low Risk

Item: Fence - Chainlink
Manufacturer: Not Identified
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

There is some damage to the fence sections - Monitor for any further deterioration and repair as required

i 4 - Very Low Risk

Item: Bench
Manufacturer: Not Identified
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 4 - Very Low Risk

Item: Litter Bin
Manufacturer: Wybone
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 6 - Low Risk

Item: 1 Bay Mixed Seat, 1 Cradle, 1 Flat
Manufacturer: Playdale Playgrounds Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 5

Finding 1

There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process - Monitor for any deterioration (rot) and replace as required

Finding 2

There is some wear to the shackles - Monitor for any further deterioration and replace when 40% worn

Finding 3

There is some notable evidence of chain wear - Monitor for any further deterioration and replace when 40% worn

Finding 4

The seat has minor damage or wear - Monitor for any further deterioration and replace as required

Finding 5

The bushes are showing signs of wear - Monitor for any further deterioration and replace as required

i 4 - Very Low Risk

Item: Spring See-Saw
Manufacturer: Ledon
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 6 - Low Risk

Item: Jeep
Manufacturer: Not Identified
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

There is some damage to the item - Monitor for any further deterioration and repair as required

i 8 - Low Risk

Item: Multi Play (Junior)
Manufacturer: Playforce
Surface Type: Grass Matrix Tiles
Item Part Number: Jungle tops
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes
Total Findings: 3



Finding 1

The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will accelerate the rotting process - Monitor to ensure the splits do not cross through fixing points of the structure and/or cause any instability

Finding 2

The ropes/nets are worn/damaged in places - Monitor for any further deterioration and repair or replace as required

Finding 3

There is algae or moss on the surface of the equipment - Clean and treat appropriately

Findings information

8 - Low Risk (Finding 1)

Item: Gates - Gate - Self Closing
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: The gate is closing too quickly (less than 4 seconds)

Action: Take corrective action to ensure that the gate closes in 4-8 seconds

6 - Low Risk (Finding 2)

Item: Gates - Gate - Self Closing
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: There is some damage to the item and is slightly out of alignment

Action: Monitor for any further deterioration and repair as required

i 6 - Low Risk (Finding 1)

Item: Fences - Fence - Chainlink
Manufacturer: Not Identified
Risk Level: L - Low Risk
Surface: Grass



Finding: There is some damage to the fence sections
Action: Monitor for any further deterioration and repair as required

i 6 - Low Risk (Finding 1)

Item: Swings - 1 Bay Mixed Seat, 1 Cradle, 1 Flat
Manufacturer: Playdale Playgrounds Ltd
Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process
Action: Monitor for any deterioration (rot) and replace as required

i 6 - Low Risk (Finding 2)

Item: Swings - 1 Bay Mixed Seat, 1 Cradle, 1 Flat
Manufacturer: Playdale Playgrounds Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is some wear to the shackles

Action: Monitor for any further deterioration and replace when 40% worn

i 6 - Low Risk (Finding 3)

Item: Swings - 1 Bay Mixed Seat, 1 Cradle, 1 Flat
Manufacturer: Playdale Playgrounds Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is some notable evidence of chain wear

Action: Monitor for any further deterioration and replace when 40% worn

i 6 - Low Risk (Finding 4)

Item: Swings - 1 Bay Mixed Seat, 1 Cradle, 1 Flat
Manufacturer: Playdale Playgrounds Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The seat has minor damage or wear

Action: Monitor for any further deterioration and replace as required

i 4 - Very Low Risk (Finding 5)

Item: Swings - 1 Bay Mixed Seat, 1 Cradle, 1 Flat
Manufacturer: Playdale Playgrounds Ltd

Risk Level: V - Very Low Risk
Surface: Grass Matrix Tiles



Finding: The bushes are showing signs of wear

Action: Monitor for any further deterioration and replace as required

i 6 - Low Risk (Finding 1)

Item: Other - Jeep
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: There is some damage to the item

Action: Monitor for any further deterioration and repair as required

i 6 - Low Risk (Finding 1)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Playforce

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will accelerate the rotting process

Action: Monitor to ensure the splits do not cross through fixing points of the structure and/or cause any instability

i 6 - Low Risk (Finding 2)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Playforce

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The ropes/nets are worn/damaged in places

Action: Monitor for any further deterioration and repair or replace as required

i 8 - Low Risk (Finding 3)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Playforce

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is algae or moss on the surface of the equipment

Action: Clean and treat appropriately



Wickhambrook Pocket Park 1

Inspection Ref: 2286217

Site Ref: 5346

Operational Inspection - 7-February-2024 - 08:52 Inspector Philip Smith

Risk Assessment: 8 Low Risk



Location:

The site is located in an area of public open space and is not directly overlooked by any properties in the local community.

Disabled Access:

Some accessible features; an area that presents difficulties to the majority of people with disabilities but in favourable circumstances and certainly in partnership can be accessed.



i 8 - Low Risk

Item: Site General
Manufacturer: Owner/Operator
Surface Type: N/A
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 2



Finding 1

There is moderate damage to the surface - Repair the damaged areas of surfacing

Finding 2

The concrete is breaking up around the edges of the surface - Repair the damaged concrete

i 4 - Very Low Risk

Item: Fence - Bow Top
Manufacturer: Not Identified
Surface Type: Bitmac
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -



i 8 - Low Risk

Item: Litter Bin
Manufacturer: Not Identified
Surface Type: N/A
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

There is some damage to the item exposing sharp edges - Replace

i 4 - Very Low Risk

Item: Ball Games Area
Manufacturer: Sovereign Leisure
Surface Type: Tarmac
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

The net has become detached - Repair

Findings information

8 - Low Risk (Finding 1)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: L - Low Risk
Surface: N/A



Finding: There is moderate damage to the surface

Action: Repair the damaged areas of surfacing

8 - Low Risk (Finding 2)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: L - Low Risk
Surface: N/A



Finding: The concrete is breaking up around the edges of the surface

Action: Repair the damaged concrete

i 8 - Low Risk (Finding 1)

Item: Ancillary Items - Litter Bin
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: N/A



Finding: There is some damage to the item exposing sharp edges
Action: Replace

i 4 - Very Low Risk (Finding 1)

Item: Multi Use Games Area - Ball Games Area
Manufacturer: Sovereign Leisure

Risk Level: V - Very Low Risk
Surface: Tarmac



Finding: The net has become detached
Action: Repair

Wickhambrook Skate Park

Inspection Ref: 2286218

Site Ref: 5343

Operational Inspection - 7-February-2024 - 08:55 Inspector Philip Smith

Risk Assessment: 8 Low Risk



Location:

The site is located in an area of public open space and is not directly overlooked by any properties in the local community.

Disabled Access:

Some accessible features; an area that presents difficulties to the majority of people with disabilities but in favourable circumstances and certainly in partnership can be accessed.

i 8 - Low Risk

Item: Site General
Manufacturer: Owner/Operator
Surface Type: N/A
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 4



Finding 1

There is weed / vegetation growth on, between, or around the edges of the surfacing - Remove weed / vegetation growth

Finding 2

There is root damage to the surfacing creating unforeseen changes in levels - Repair the damaged areas of tarmac to provide a uniform surface

Finding 3

There is some damage apparent to the riding surface - Monitor for any further deterioration and repair as required

Finding 4

There is algae, silt or moss growth on the surface resulting in slippery conditions - Clean and treat appropriately

i 4 - Very Low Risk

Item: Litter Bin
Manufacturer: Not Identified
Surface Type: Bitmac
Item Part Number:
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A
Total Findings: 1



Finding 1

This item is satisfactory - no work required -

i 6 - Low Risk

Item: Fence - Bow Top
Manufacturer: Not Identified
Surface Type: Bitmac
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

There is some damage to the fence sections - Monitor for any further deterioration and repair as required

i 6 - Low Risk

Item: Shelter
Manufacturer: Not Identified
Surface Type: Tarmac
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 3

Finding 1

There is some evidence of fire damage to the item - Monitor for any further deterioration and repair as required

Finding 2

Pop rivet fixings have failed on the seat - Replace the failed pop rivets

Finding 3

There is surface corrosion / rust present on the item - Consider treating the item



i 6 - Low Risk

Item: Grind Rail
Manufacturer: Eibe Play Ltd
Surface Type: Tarmac
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

There is surface corrosion / rust present on the item - Consider treating the item

i 6 - Low Risk

Item: Grind Rail
Manufacturer: Eibe Play Ltd
Surface Type: Tarmac
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

There is surface corrosion / rust present on the item - Consider treating the item

i 6 - Low Risk

Item: Grind Box
Manufacturer: Eibe Play Ltd
Surface Type: Tarmac
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

There is surface corrosion / rust present on the item - Consider treating the item

i 6 - Low Risk

Item: Quarter Pipe
Manufacturer: Eibe Play Ltd
Surface Type: Tarmac
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes



Total Findings: 2

Finding 1

The item has been damaged - Monitor for any further deterioration and replace as required

Finding 2

The riding surface of the ramp has some damage apparent - Monitor for any further deterioration and repair as required

i 4 - Very Low Risk

Item: Platform Ramp
Manufacturer: Eibe Play Ltd
Surface Type: Tarmac
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 6 - Low Risk

Item: Half Pipe
Manufacturer: Eibe Play Ltd
Surface Type: Tarmac
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes



Total Findings: 1

Finding 1


A number of fixing(s) have worked loose - Secure all loose fixings

Findings information

6 - Low Risk (Finding 1)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: L - Low Risk
Surface: N/A

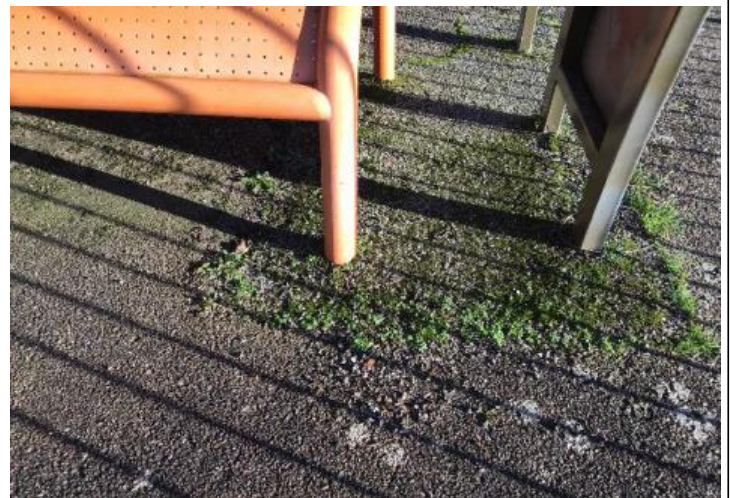

Finding: There is weed / vegetation growth on, between, or around the edges of the surfacing
Action: Remove weed / vegetation growth

i 8 - Low Risk (Finding 2)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: L - Low Risk
Surface: N/A



Finding: There is root damage to the surfacing creating unforeseen changes in levels

Action: Repair the damaged areas of tarmac to provide a uniform surface

i 6 - Low Risk (Finding 3)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: L - Low Risk
Surface: N/A



Finding: There is some damage apparent to the riding surface

Action: Monitor for any further deterioration and repair as required

i 8 - Low Risk (Finding 4)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: L - Low Risk
Surface: N/A



Finding: There is algae, silt or moss growth on the surface resulting in slippery conditions
Action: Clean and treat appropriately

i 6 - Low Risk (Finding 1)

Item: Fences - Fence - Bow Top
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Bitmac



Finding: There is some damage to the fence sections
Action: Monitor for any further deterioration and repair as required

i 6 - Low Risk (Finding 1)

Item: Ancillary Items - Shelter
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Tarmac




Finding: There is some evidence of fire damage to the item **Action:** Monitor for any further deterioration and repair as required

i 6 - Low Risk (Finding 2)

Item: Ancillary Items - Shelter
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Tarmac

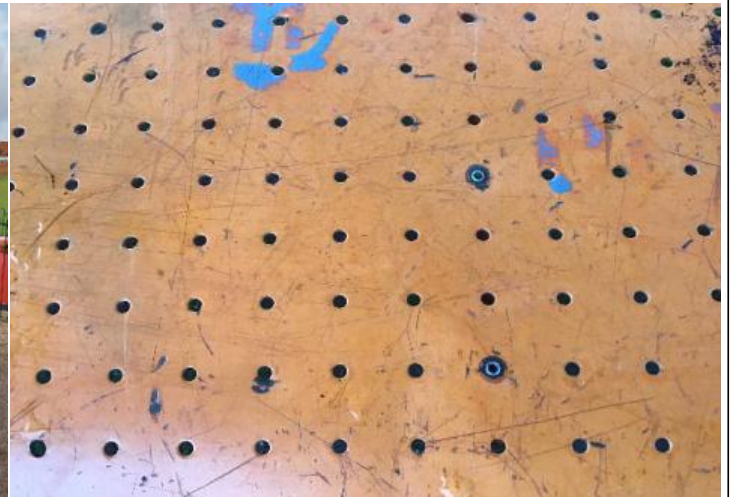

Finding: Pop rivet fixings have failed on the seat **Action:** Replace the failed pop rivets

i 6 - Low Risk (Finding 3)

Item: Ancillary Items - Shelter
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Tarmac



Finding: There is surface corrosion / rust present on the item

Action: Consider treating the item

i 6 - Low Risk (Finding 1)

Item: Wheeled Sports - Grind Rail
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Tarmac



Finding: There is surface corrosion / rust present on the item

Action: Consider treating the item

i 6 - Low Risk (Finding 1)

Item:	Wheeled Sports - Grind Rail	Risk Level:	L - Low Risk
Manufacturer:	Eibe Play Ltd	Surface:	Tarmac



Finding: There is surface corrosion / rust present on the item
Action: Consider treating the item

i 6 - Low Risk (Finding 1)

Item:	Wheeled Sports - Grind Box	Risk Level:	L - Low Risk
Manufacturer:	Eibe Play Ltd	Surface:	Tarmac



Finding: There is surface corrosion / rust present on the item
Action: Consider treating the item

i 6 - Low Risk (Finding 1)

Item: Wheeled Sports - Quarter Pipe
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Tarmac



Finding: The item has been damaged

Action: Monitor for any further deterioration and replace as required

i 6 - Low Risk (Finding 2)

Item: Wheeled Sports - Quarter Pipe
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Tarmac




Finding: The riding surface of the ramp has some damage apparent

Action: Monitor for any further deterioration and repair as required

i 6 - Low Risk (Finding 1)

Item: Wheeled Sports - Half Pipe
Manufacturer: Eibe Play Ltd

Risk Level: L - Low Risk
Surface: Tarmac

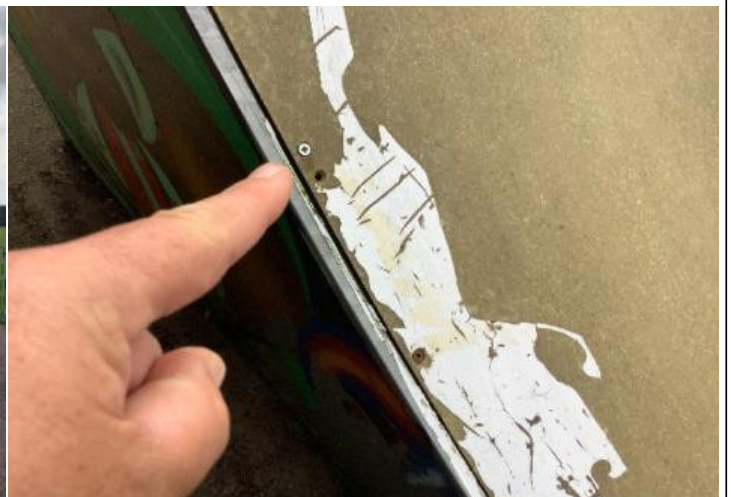

Finding: A number of fixing(s) have worked loose

Action: Secure all loose fixings



Wickhambrook

Inspection Ref: 2286219

Site Ref: 5341

Operational Inspection - 7-February-2024 - 09:59 Inspector Philip Smith

Risk Assessment: 8 Low Risk



Location:

The site is located in an area of public open space and is not directly overlooked by any properties in the local community.

Disabled Access:

Some accessible features; an area that presents difficulties to the majority of people with disabilities but in favourable circumstances and certainly in partnership can be accessed.

i 8 - Low Risk

Item: Site General
Manufacturer: Owner/Operator
Surface Type: N/A
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

There is a redundant concrete base causing trip hazards in the play area - Remove the concrete and reinstate

i 4 - Very Low Risk

Item: Sign
Manufacturer: Owner/Operator
Surface Type: N/A
Item Part Number:
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A
Total Findings: 1



Finding 1

This item is satisfactory - no work required -

i 8 - Low Risk

Item: Gate - Self Closing
Manufacturer: Easy Gate Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 2
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

There are trip hazards at the edges of the surface - Reinstate surrounding surface levels to remove the trip points

i 4 - Very Low Risk

Item: Gate - Maintenance
Manufacturer: Not Identified
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 6 - Low Risk

Item: Fencing - Timber
Manufacturer: Not Identified
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 3



Finding 1

There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process - Monitor for any deterioration (rot) and replace as required

Finding 2

The adjacent foliage is overhanging - Cut back and maintain

Finding 3

There is some damage to the item - Monitor for any further deterioration and repair as required

i 4 - Very Low Risk

Item: Picnic Table
Manufacturer: Not Identified
Surface Type: Grass
Item Quantity: 2
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -

i 6 - Low Risk

Item: Litter Bin
Manufacturer: Not Identified
Surface Type: Grass
Item Part Number:
Item Quantity: 2
Equipment Compliance: N/A
Surface Area Compliance: N/A
Total Findings: 1



Finding 1

The paintwork on this item has been damaged or worn exposing the metal underneath which is rusting / corroding - Treat affected areas and repaint

i 4 - Very Low Risk

Item: Bench
Manufacturer: Not Identified
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A
Total Findings: 1



Finding 1

This item is satisfactory - no work required -

i 4 - Very Low Risk

Item: Spring Snail
Manufacturer: Miracle Recreation Equipment Company
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

A number of fixing(s) have worked loose - Secure all loose fixings

i 4 - Very Low Risk

Item: Spring Bee
Manufacturer: Miracle Recreation Equipment Company
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

A number of fixing(s) have worked loose - Secure all loose fixings

i 4 - Very Low Risk

Item: Spinner Bowl
Manufacturer: Sutcliffe Play Limited
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 8 - Low Risk

Item: 1 Bay 2 Seat (Cradle)
Manufacturer: Miracle Recreation Equipment Company
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes



Total Findings: 3

Finding 1

The grass mats are silted up and the soil is compacted; this may have an effect on the impact absorbing properties of the surface - Consider HIC testing impact absorbing properties to ensure the correct surface qualities are maintained for the equipment and replace as required

Finding 2

There is some notable evidence of chain wear - Monitor for any further deterioration and replace when 40% worn

Finding 3

The swing seat connectors have some wear present - Monitor for further deterioration and replace when 40% worn

i 8 - Low Risk

Item: Stepping Posts Timber
Manufacturer: Playworld Systems (Europe) Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 3

Finding 1

There is algae or moss on the surface of the equipment - Clean and treat appropriately

Finding 2

There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process - Monitor for any deterioration (rot) and replace as required

Finding 3

The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will accelerate the rotting process - Monitor to ensure the splits do not cross through fixing points of the structure and/or cause any instability

i 8 - Low Risk

Item: Embankment Slide
Manufacturer: Miracle Recreation Equipment Company
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes



Total Findings: 2

Finding 1

The surface has eroded in some areas and may be slippery in wet conditions - Reinstate the surface

Finding 2

There are trip hazards at the edges of the surface - Reinstate surrounding surface levels to remove the trip points



i 8 - Low Risk

Item: Activity Trail
Manufacturer: Miracle Recreation Equipment Company
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes



Total Findings: 7

Finding 1

There is/are bolt cap covers missing or damaged on the item - Replace missing or damaged bolt cap covers

Finding 2

There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process - Monitor for any deterioration (rot) and replace as required

Finding 3

The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will accelerate the rotting process - Monitor to ensure the splits do not cross through fixing points of the structure and/or cause any instability

Finding 4

There is algae or moss on the surface of the equipment - Clean and treat appropriately

Finding 5

The ropes/nets are worn/damaged in places - Monitor for any further deterioration and repair or replace as required

Finding 6

Parts of the timber are rough or splintered - Remove all rough or sharp edges

Finding 7

A number of fixing(s) have worked loose - Secure all loose fixings

i 8 - Low Risk

Item: 2 Bay 2 Flat 1 Basket Seat
Manufacturer: Miracle Recreation Equipment Company
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes



Total Findings: 7

Finding 1

There is moderate damage to the surface - Repair the damaged areas of surfacing

Finding 3

The swing seat connectors have some wear present - Monitor for further deterioration and replace when 40% worn

Finding 5

The seat has minor damage or wear - Monitor for any further deterioration and replace as required

Finding 7

The paint is flaking off the metalwork - Rub down and re-paint

Finding 2

There are gaps opening between the grass mat tiles - Provide additional ties or secure / reinstate surface

Finding 4

There is some notable evidence of chain wear - Monitor for any further deterioration and replace when 40% worn

Finding 6

There is algae or moss on the surface of the equipment - Clean and treat appropriately

i 4 - Very Low Risk

Item: Supernova
Manufacturer: Kompan Ltd
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 4 - Very Low Risk

Item: Overhead Rotator
Manufacturer: Miracle Recreation Equipment Company
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 1

Finding 1

This item is satisfactory - no work required -

i 8 - Low Risk

Item: Multi Play (Senior)
Manufacturer: Miracle Recreation Equipment Company
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes



Total Findings: 4

Finding 1

The tree canopy overhangs the equipment and is less than 2.0m away - Lift tree canopy to ensure a minimum clearance of 2.0m from the equipment

Finding 2

There is algae or moss on the surface of the equipment - Clean and treat appropriately

Finding 3

A number of fixing(s) have worked loose - Secure all loose fixings

Finding 4

There are a number of dents in the slide surface - Monitor for any further deterioration and repair as required

i 6 - Low Risk

Item: Log Walk
Manufacturer: Miracle Recreation Equipment Company
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes



Total Findings: 2

Finding 1

The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will accelerate the rotting process - Monitor to ensure the splits do not cross through fixing points of the structure and/or cause any instability

Finding 2

There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process - Monitor for any deterioration (rot) and replace as required

i 8 - Low Risk

Item: Climbing Frame
Manufacturer: Not Identified
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes



Total Findings: 4

Finding 1

There is/are bolt cap covers missing or damaged on the item - Replace missing or damaged bolt cap covers

Finding 2

There is algae or moss on the surface of the equipment - Clean and treat appropriately

Finding 3

The ropes/nets are worn/damaged in places - Monitor for any further deterioration and repair or replace as required

Finding 4

The connecting lugs are showing signs of wear - Monitor for any further deterioration and repair as required

i 8 - Low Risk

Item: Cable Runway
Manufacturer: Fenland Leisure Products
Surface Type: Grass Matrix Tiles
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes

Total Findings: 7



Finding 1

We have completed a visual inspection of the suspension links, cable and fixing points from ground level, however it is not possible to fully inspect these areas without either hiring equipment to gain access or removing the cable and suspension and inspecting at ground level. We recommend that the main cable and fixing security is thoroughly inspected at least in accordance with the manufacturers recommendations to check for wear, damage, security or internal rusting; this will help to ensure the continued safe use of the equipment - Inspect in accordance with the manufacturers recommendations

Finding 2

The seat connection cannot be inspected without dismantling the seat - Dismantle the seat to inspect the seat connection for wear

Finding 3

The cableway seat has been damaged - Monitor for any further deterioration and replace as required

Finding 4

The nylon inserts are worn or missing at the point the cable enters the traveller - Replace worn or missing inserts as required

Finding 5

There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process - Monitor for any deterioration (rot) and replace as required

Finding 6

There is algae or moss on the surface of the equipment - Clean and treat appropriately

Finding 7

There are a number of redundant staples attached to the equipment - Remove redundant staples

Findings information

i 8 - Low Risk (Finding 1)			
Item:	Ancillary Items - Site General	Risk Level:	L - Low Risk
Manufacturer:	Owner/Operator	Surface:	N/A
			
Finding: There is a redundant concrete base causing trip hazards in the play area		Action: Remove the concrete and reinstate	

i 8 - Low Risk (Finding 1)

Item: Gates - Gate - Self Closing
Manufacturer: Easy Gate Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There are trip hazards at the edges of the surface

Action: Reinststate surrounding surface levels to remove the trip points

i 6 - Low Risk (Finding 1)

Item: Fences - Fencing - Timber
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process

Action: Monitor for any deterioration (rot) and replace as required

i 6 - Low Risk (Finding 2)

Item: Fences - Fencing - Timber
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: The adjacent foliage is overhanging

Action: Cut back and maintain

i 6 - Low Risk (Finding 3)

Item: Fences - Fencing - Timber
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: There is some damage to the item

Action: Monitor for any further deterioration and repair as required

i 6 - Low Risk (Finding 1)

Item: Ancillary Items - Litter Bin
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: The paintwork on this item has been damaged or worn exposing the metal underneath which is rusting / corroding

Action: Treat affected areas and repaint

i 4 - Very Low Risk (Finding 1)

Item: Rocking Equipment - Spring Snail
Manufacturer: Miracle Recreation Equipment Company

Risk Level: V - Very Low Risk
Surface: Grass Matrix Tiles



Finding: A number of fixing(s) have worked loose

Action: Secure all loose fixings

i 4 - Very Low Risk (Finding 1)

Item: Rocking Equipment - Spring Bee
Manufacturer: Miracle Recreation Equipment Company

Risk Level: V - Very Low Risk
Surface: Grass Matrix Tiles



Finding: A number of fixing(s) have worked loose

Action: Secure all loose fixings

i 8 - Low Risk (Finding 1)

Item: Swings - 1 Bay 2 Seat (Cradle)
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The grass mats are silted up and the soil is compacted; this may have an effect on the impact absorbing properties of the surface

Action: Consider HIC testing impact absorbing properties to ensure the correct surface qualities are maintained for the equipment and replace as required

i 6 - Low Risk (Finding 2)

Item: Swings - 1 Bay 2 Seat (Cradle)
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is some notable evidence of chain wear

Action: Monitor for any further deterioration and replace when 40% worn

i 6 - Low Risk (Finding 3)

Item: Swings - 1 Bay 2 Seat (Cradle)
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The swing seat connectors have some wear present

Action: Monitor for further deterioration and replace when 40% worn

i 8 - Low Risk (Finding 1)

Item: Activity Equipment - Stepping Posts
 Timber
Manufacturer: Playworld Systems (Europe) Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is algae or moss on the surface of the equipment

Action: Clean and treat appropriately

i 6 - Low Risk (Finding 2)

Item: Activity Equipment - Stepping Posts
 Timber
Manufacturer: Playworld Systems (Europe) Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process

Action: Monitor for any deterioration (rot) and replace as required

i 6 - Low Risk (Finding 3)

Item: Activity Equipment - Stepping Posts
 Timber
Manufacturer: Playworld Systems (Europe) Ltd

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will accelerate the rotting process
Action: Monitor to ensure the splits do not cross through fixing points of the structure and/or cause any instability

i 6 - Low Risk (Finding 1)

Item: Other - Embankment Slide
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The surface has eroded in some areas and may be slippery in wet conditions
Action: Reinststate the surface

i 8 - Low Risk (Finding 2)

Item: Other - Embankment Slide
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There are trip hazards at the edges of the surface

Action: Reinstate surrounding surface levels to remove the trip points

i 4 - Very Low Risk (Finding 1)

Item: Activity Equipment - Activity Trail
Manufacturer: Miracle Recreation Equipment Company

Risk Level: V - Very Low Risk
Surface: Grass Matrix Tiles



Finding: There is/are bolt cap covers missing or damaged on the item

Action: Replace missing or damaged bolt cap covers

i 6 - Low Risk (Finding 2)

Item: Activity Equipment - Activity Trail
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process

Action: Monitor for any deterioration (rot) and replace as required

i 6 - Low Risk (Finding 3)

Item: Activity Equipment - Activity Trail
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will accelerate the rotting process
Action: Monitor to ensure the splits do not cross through fixing points of the structure and/or cause any instability

i 8 - Low Risk (Finding 4)

Item: Activity Equipment - Activity Trail
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is algae or moss on the surface of the equipment
Action: Clean and treat appropriately

i 6 - Low Risk (Finding 5)

Item: Activity Equipment - Activity Trail
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The ropes/nets are worn/damaged in places

Action: Monitor for any further deterioration and repair or replace as required

i 6 - Low Risk (Finding 6)

Item: Activity Equipment - Activity Trail
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: Parts of the timber are rough or splintered

Action: Remove all rough or sharp edges

i 6 - Low Risk (Finding 7)

Item: Activity Equipment - Activity Trail
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: A number of fixing(s) have worked loose

Action: Secure all loose fixings

i 8 - Low Risk (Finding 1)

Item: Swings - 2 Bay 2 Flat 1 Basket Seat
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is moderate damage to the surface

Action: Repair the damaged areas of surfacing

i 6 - Low Risk (Finding 2)

Item: Swings - 2 Bay 2 Flat 1 Basket Seat
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles




Finding: There are gaps opening between the grass mat tiles

Action: Provide additional ties or secure / reinstate surface tiles

i 6 - Low Risk (Finding 3)

Item: Swings - 2 Bay 2 Flat 1 Basket Seat
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles

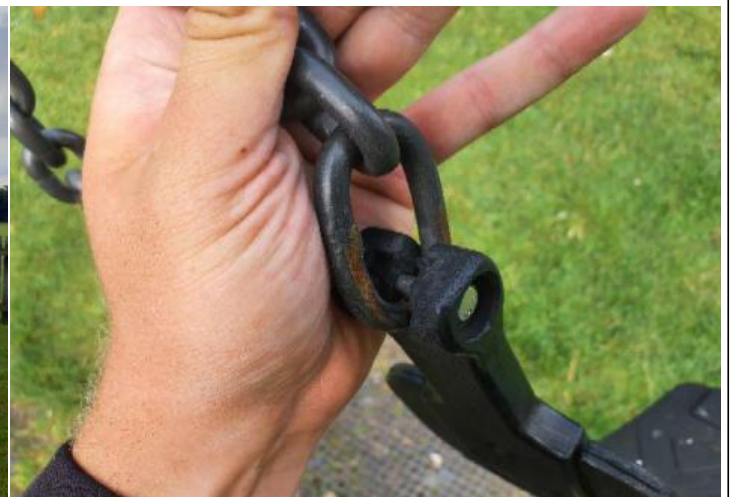

Finding: The swing seat connectors have some wear present

Action: Monitor for further deterioration and replace when 40% worn

i 6 - Low Risk (Finding 4)

Item: Swings - 2 Bay 2 Flat 1 Basket Seat
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is some notable evidence of chain wear

Action: Monitor for any further deterioration and replace when 40% worn

i 6 - Low Risk (Finding 5)

Item: Swings - 2 Bay 2 Flat 1 Basket Seat
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The seat has minor damage or wear

Action: Monitor for any further deterioration and replace as required

i 6 - Low Risk (Finding 6)

Item: Swings - 2 Bay 2 Flat 1 Basket Seat
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is algae or moss on the surface of the equipment

Action: Clean and treat appropriately

i 6 - Low Risk (Finding 7)

Item: Swings - 2 Bay 2 Flat 1 Basket Seat
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The paint is flaking off the metalwork

Action: Rub down and re-paint

6 - Low Risk (Finding 1)

Item: Activity Equipment - Multi Play (Senior)
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The tree canopy overhangs the equipment and is less than 2.0m away

Action: Lift tree canopy to ensure a minimum clearance of 2.0m from the equipment

8 - Low Risk (Finding 2)

Item: Activity Equipment - Multi Play (Senior)
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is algae or moss on the surface of the equipment

Action: Clean and treat appropriately

i 6 - Low Risk (Finding 3)

Item: Activity Equipment - Multi Play (Senior)
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: A number of fixing(s) have worked loose

Action: Secure all loose fixings

i 4 - Very Low Risk (Finding 4)

Item: Activity Equipment - Multi Play (Senior)
Manufacturer: Miracle Recreation Equipment Company

Risk Level: V - Very Low Risk
Surface: Grass Matrix Tiles



Finding: There are a number of dents in the slide surface

Action: Monitor for any further deterioration and repair as required

i 6 - Low Risk (Finding 1)

Item: Activity Equipment - Log Walk
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The timber has a number of splits/shakes or air cracks and this may affect the stability or allow water ingress which will accelerate the rotting process
Action: Monitor to ensure the splits do not cross through fixing points of the structure and/or cause any instability

i 6 - Low Risk (Finding 2)

Item: Activity Equipment - Log Walk
Manufacturer: Miracle Recreation Equipment Company

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process
Action: Monitor for any deterioration (rot) and replace as required

i 4 - Very Low Risk (Finding 1)

Item: Activity Equipment - Climbing Frame
Manufacturer: Not Identified

Risk Level: V - Very Low Risk
Surface: Grass Matrix Tiles



Finding: There is/are bolt cap covers missing or damaged on the item

Action: Replace missing or damaged bolt cap covers

i 8 - Low Risk (Finding 2)

Item: Activity Equipment - Climbing Frame
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is algae or moss on the surface of the equipment

Action: Clean and treat appropriately

i 6 - Low Risk (Finding 3)

Item: Activity Equipment - Climbing Frame
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The ropes/nets are worn/damaged in places

Action: Monitor for any further deterioration and repair or replace as required

i 6 - Low Risk (Finding 4)

Item: Activity Equipment - Climbing Frame
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The connecting lugs are showing signs of wear

Action: Monitor for any further deterioration and repair as required

i 0 - Risk Assessment not Undertaken (Finding 1)

Item:	Other - Cable Runway	Risk Level:	N - Risk Assessment not Undertaken
Manufacturer:	Fenland Leisure Products	Surface:	Grass Matrix Tiles



Finding: We have completed a visual inspection of the suspension links, cable and fixing points from ground level, however it is not possible to fully inspect these areas without either hiring equipment to gain access or removing the cable and suspension and inspecting at ground level. We recommend that the main cable and fixing security is thoroughly inspected at least in accordance with the manufacturers recommendations to check for wear, damage, security or internal rusting; this will help to ensure the continued safe use of the equipment

Action: Inspect in accordance with the manufacturers recommendations

i 0 - Risk Assessment not Undertaken (Finding 2)

Item: Other - Cable Runway
Manufacturer: Fenland Leisure Products

Risk Level: N - Risk Assessment not Undertaken
Surface: Grass Matrix Tiles



Finding: The seat connection cannot be inspected without dismantling the seat

Action: Dismantle the seat to inspect the seat connection for wear

i 6 - Low Risk (Finding 3)

Item: Other - Cable Runway
Manufacturer: Fenland Leisure Products

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: The cableway seat has been damaged

Action: Monitor for any further deterioration and replace as required

i 5 - Very Low Risk (Finding 4)

Item: Other - Cable Runway
Manufacturer: Fenland Leisure Products

Risk Level: V - Very Low Risk
Surface: Grass Matrix Tiles



Finding: The nylon inserts are worn or missing at the point the cable enters the traveller

Action: Replace worn or missing inserts as required

i 6 - Low Risk (Finding 5)

Item: Other - Cable Runway
Manufacturer: Fenland Leisure Products

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process

Action: Monitor for any deterioration (rot) and replace as required

i 8 - Low Risk (Finding 6)

Item: Other - Cable Runway
Manufacturer: Fenland Leisure Products

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There is algae or moss on the surface of the equipment

Action: Clean and treat appropriately

i 6 - Low Risk (Finding 7)

Item: Other - Cable Runway
Manufacturer: Fenland Leisure Products

Risk Level: L - Low Risk
Surface: Grass Matrix Tiles



Finding: There are a number of redundant staples attached to the equipment **Action:** Remove redundant staples

Ms Hilary Workman
 Wickhambrook Parish Council
 123 York Road
 Bury St Edmunds
 Suffolk
 IP33 3EG
 England

Ref: 62937
 Thursday, 18 January 2024


Dear Hilary

Playground Maintenance Estimate for Wickhambrook x 3 sites

Thank you for your enquiry regarding our maintenance services, I am pleased to enclose an estimate for the work as requested.






All our maintenance work is carried out to the European Standards of EN1176, EN1177 and EN16630. OLP is accredited to both ISO9001:2015 (Quality Assurance), ISO 45001:2018 (Health and Safety Systems) and all our inspectors and field engineers also hold DBS certificates so you can be assured your repairs will be carried out to the highest possible standards of both quality and safety.

Maintenance Estimate No.: 62937



Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Bury Road - Gate - Review & Adjustment					
	PRELIM-04	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177	1.0	£70.00	£70.00

Subtotal £70.00

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Bury Road - Bay Mixed Seat - Findings 2,3,4 & 5					
	COMSWISHA0011	SW15-12REC - Record / Sutcliffe / Playdale Shackle / Bolt 12mm X 26mm X 50mm	4.0	£4.10	£16.40

	COMSWIOIL0020	SW11 Playdale Oilite Bush - F400 12 x 22 x 16mm I/D x O/D x Length	4.0	£6.70	£26.80
	SUBSWISTR6M001C	SWC10C - 6mm Stainless Steel straight swing chains per pair for cradle seats.	1.0	£72.00	£72.00
	COMWISEA0004	Sw22 - Premium Cradle Swing Seat	1.0	£102.00	£102.00
	BASE36	To breakout existing post and foundation, prepare foundation hole and re-concrete. - Each	4.0	£207.00	£828.00
	PRELIM-04	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177	4.0	£70.00	£280.00
	SUBSTEMIS0009	140mm to 160mm Diameter Post Foot Foundation including M12 x 180mm stainless steel coachbolts, washer nyloc and two part cap.	4.0	£60.00	£240.00






Subtotal £1,565.20


Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Bury Road - Multi Play - Replacement Rope - attached to existing fixings					
	WEBCLIROP	Single 16mm steelcore combination ropes complete with two end fittings. Length - ***** Colour - ***** End Fitting - *****	1.0	£53.70	£53.70
	PRELIM-04	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177	1.0	£70.00	£70.00

Subtotal £123.70



Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Skate Park - Shelter & Half Pipe					
	COMHARNAI0025	Flange Pop Rivets Fixing 16mm Head 4.8 x 20mm in Stainless Steel with serrated edges.	25.0	£0.37	£9.25
	COMHARMIS0004	Misc Bolt Pack including bolts, nuts, washers and protection caps.	1.0	£10.00	£10.00
	DESLAINS010	To carryout minor tightening of fixings or sanding on an item of playground or fitness equipment	1.0	£32.00	£32.00

Subtotal £51.25




Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Wickhambrook - Springers x 2					
		Existing springs beyond economical repair	2.0	£0.00	£0.00
	BASE36	To breakout existing post and foundation, prepare foundation hole and re-concrete. - Each	2.0	£207.00	£414.00
	PRELIM-04	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177	2.0	£70.00	£140.00
	MSPA05	Willy Whale Sit In Spring Rocker produced in low maintenance HDPE with a set of ground anchors. TUV certified to EN1176. Suitable for age range 1 to 4.	1.0	£740.00	£740.00
	PRO-INST-4	Product assembly and installation into a soft dig with good access including concrete foundations	1.0	£225.00	£225.00
	MSPA11	Motorbike & Sidecar Spring Rocker produced in low maintenance HDPE with a set of ground anchors. TUV certified to EN1176. Suitable for age range 1 to 6.	1.0	£1,360.00	£1,360.00


	PRO-INST-6	Product assembly and installation into a soft dig with good access including concrete foundations	1.0	£315.00	£315.00
---	------------	---	-----	---------	---------

Subtotal £3,194.00





Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Wickhambrook - 1 Bay 2 Seat Cradle					
	SUBSWISTR6M001C	SWC10C - 6mm Stainless Steel straight swing chains per pair for cradle seats.	2.0	£72.00	£144.00
	COMWISEA0004	Sw22 - Premium Cradle Swing Seat	2.0	£102.00	£204.00
	PRELIM-04	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177	2.0	£70.00	£140.00

Subtotal £488.00


Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Activity Trail - bolt caps, nets, sanding & tightening of bolts					
	COMPLACAP0001	F13 - 34mm Round Insert Cap - BK (Suits holes between 28 - 32mm) ** This cap used in OLP Production*	2.0	£0.40	£0.80
	WEBCARNET	Cargo Access Net manufactured from 16mm steelcore combination rope with fixings on top and both sides. Side A: **** Side B ***** Colour: ***** Fixing Type: **** 1325 x 1650mm	1.0	£750.00	£750.00
	PRELIM-04	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177	2.0	£70.00	£140.00


	DESLAINS010	To carryout minor tightening of fixings or sanding on an item of playground or fitness equipment	1.5	£32.00	£48.00
---	-------------	--	-----	--------	--------

Subtotal £938.80

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
2 bay 2 flat & 1 basket seat					
	COMSWISEA0001	Sw19 - Large Swing Seat	2.0	£43.00	£86.00
	SUBSWISTR0002	SWC4-3.0F - Straight Flat Seat Chain (pair)	2.0	£55.00	£110.00
	COMSWISEA0007	Sw25.2 - 1M Birds Nest Swing Seat In Blue / Red Rope With 2 Point Suspension	1.0	£575.00	£575.00
	PRELIM-04	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177	3.5	£70.00	£245.00

Subtotal £1,016.00



Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Multi-Play - Monorail - Investigation of sliding handle					
		We will check monorail when on site – as this was repaired in September, possible inspector error	1.0	£0.00	£0.00
	DESLAINS010	To carryout minor tightening of fixings or sanding on an item of playground or fitness equipment	1.0	£32.00	£32.00

	COMCOA009	P16 - Multipurpose Lubricating Oil - 100ml	1.0	£2.50	£2.50
---	-----------	--	-----	-------	-------





Subtotal £34.50

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Climbing Frame - Investigate, disassemble and advise corrective action					
	ASSESSM-1	Playground maintenance assessment to EN1176 / EN1177 complete with quotation. This charge will be refunded from quotes ordered over £950 + VAT.	1.0	£175.00	£175.00

Subtotal £175.00

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Cableway - seat inspection/fixing & adding nylon inserts - Full Inspection certificate will be provided					
	COMCAB0009	AC3B Finger Protection Guard For R & T Stainless Cableway Trolley (sold per pair)	2.0	£12.00	£24.00
	COMCAB0005	AC9 - Sutcliffe Pendulum Seat	1.0	£90.00	£90.00
	COMSWIHANM8X30	SW84A replacement swing hanger bolt for SW5 / SW29 / SW81 swing hanger bolt assemblies - M8 x 30mm including nyloc locking nut. **BOLT TO FIX SEAT TO CABLEWAY**	1.0	£2.50	£2.50
	DESLAINS006	Aerial Cableway Service/re-tension and commission including access equipment (working at heights HSE - regulation 2005) excluding travel to site. **HAVE TO DROP CABLEWAY TO FIT NYLON INSERTS**	1.0	£440.00	£440.00

Subtotal £556.50

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Preliminaries & Travel (2trips)					
	PRELIM-03	To travel to site with up to 3 staff members per vehicle including mileage cost.	180.0	£1.90	£342.00
	PRELIM-05	To prepare maintenance works risk assessments and method statements covering playground repairs works.	1.0	£30.00	£30.00
	PRELIM-13	To hire, erect and remove fencing per panel including blocks, feet and clips - per panel. (3.5m)	6.0	£20.00	£120.00
	PRELIM-08	Environmental removal of general waste from site. All waste to be transferred to a registered recycling centre for further processing.	0.5	£280.00	£140.00

Subtotal £632.00

Total (ex. tax)	£8,844.95
Tax	£1,768.99
Total (inc. tax)	£10,613.94


Maintenance & Repairs



Replacement Ropes and Nets

2 Year Guarantee

We manufacture all our steel core combi ropes in-house so we can replace any size or length. The physical breaking load of these ropes has been laboratory tested, proving their tensile strength is more than adequate for playground and fitness trail use. They are available in a variety of colours and are all manufactured to meet EN1176.

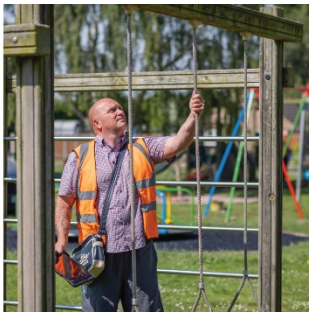

Inspections

RPII Certified

There are 3 types of playground inspection that should be carried out. A Visual Inspection that can be carried out by your own maintenance staff, an Operational Inspection that we offer from our fully qualified team and Annual Inspections to be carried out by an independent specialist.

For more information please visit www.onlineplaygrounds.com/maintenance-services, email maintenance@onlineplaygrounds.co.uk or call 01354 699482 where our dedicated team can assist with your requirements.

Project Assumptions

The following assumptions have been made regarding this quotation:

- Quotation is Valid for **60 days** from date of creation. Please contact your OLP representative, if you would like us to check and update the prices for a further period.
- Good access will be available to the site.
- Estimate or Quotation? Whilst we endeavor to provide fixed prices for all maintenance and repair works sometimes additional issues are discovered during the works. When this occurs, the client will be advised of the discovered problem and the additional cost of the repair before the further work is carried out.

Ordering Is Easy

- Call 01354 699482
- Email: maintenance@onlineplaygrounds.co.uk

Payment and Delivery Terms

If you have a **Trading Account** then the total invoice is payable within 28 days of project completion, otherwise payment in full by **Pro-forma Invoice** is required.

* All delivery times are from receipt of official order subject to seasonal demand. The delivery times of “genuine spares” unless in stock is unfortunately beyond our control and in some cases can be up to 8 weeks.

I trust the above quotation meets with your approval and look forward to receiving your further instructions. If in the meantime you need any more information or changes making to this proposal, please do not hesitate to contact me.

Yours Sincerely

Jodie Walker
Maintenance Sales Manager
jodie.walker@onlineplaygrounds.co.uk



online playgrounds

Inspection & Maintenance Services

for your play area



**Undertaking inspections and repairs
on any manufacturers play equipment**



Our Services

Here at OLP (formally Fenland Leisure Products) we have a dedicated maintenance team to give your playground or outdoor fitness area a full service using our own employed and fully qualified maintenance engineers and in-house support team.

With 30 years of experience in the industry we have both the knowledge and expertise in assessment, maintenance and repairs.

We also offer an inspection service carried out by RPII (Register of Play Inspectors International) qualified engineers who check that all equipment complies to the British & European standards of BS EN1176 & EN1177 for Commercial Playgrounds and EN16630 for Outdoor Fitness Equipment.

- RPII qualified engineers
- In house support and quotation team
- No obligation repair quote
- Quick personal service
- In house production facility dedicated to manufacturing panels, decks, roofs and nets
- Over 3000 parts in stock using our Online Playgrounds spares service.



FAQs

- **Does my play area need to be inspected**

The European Standard for Playground Safety, BS EN1176 recommends that regular inspections take place as part of a planned inspection schedule.

- **Can I carry out a playground inspection myself?**

Yes, you can carry out visual level inspections yourself. We recommend you attend a playground visual inspection training course before you attempt this. Operational and Annual Inspections must be carried out by a RPII certified engineer.

- **Do you inspect/repair any manufacturers equipment?**

We are qualified to inspect and repair any manufacturers equipment.



- **Can you undertake repairs or supply parts?**

Yes, all our Operational Inspection reports are followed by a no-obligation quotation for the works identified. This work can be undertaken on a supply and install basis or parts only.

- **Can you provide me with a quotation for repairs following an inspection by another company?**

Yes we can, provided the report contains good quality photographs showing the work which needs to be carried out. Where this is not possible, we can arrange for a Maintenance Technician to attend site to identify the parts which need replacing.

- **Can safety surfacing be repaired?**

We can repair all types of surfacing from Safagrass, Rubber Mulch, loose fill surfaces such as sand and bark through to rubber wetpour.

 +44 (0) 1354 638193

 parts@onlineplaygrounds.co.uk

 onlineplaygrounds.co.uk



Inspections Explained

VISUAL ROUTINE INSPECTION

This can be carried out by your grounds maintenance member of staff (we recommend they attend a playground visual inspection training course – contact us for details) and consists of a simple visual check to ensure equipment is safe to use. These types of inspections should be recorded with all found hazards being reported for further action.

OLP can help producing a site specific checklist.

OPERATIONAL INSPECTION

These are the key inspections that we offer from our fully qualified team. They look in more detail at the condition of the equipment,

providing a quality control check on the visual routine inspections and identifying wear and tear to the equipment. They should be carried out on a quarterly basis as a minimum and we will follow up with a detailed web-based report from our latest inspection software. This will list the findings in an accurate and easy to read format, always compliant with the latest safety legislation.

All reports are supplied with a full risk assessment which is an essential document when managing a public play space.








ANNUAL INSPECTION

These are to be carried out by an independent specialist not connected with the playground operator or owner. They will essentially look at vandalism, wear and tear, long term structural problems and the overall safety of the playground. If required, we can arrange for these inspections to be carried out through our network of independent RPII Annual Inspectors.

www.playinspectors.com
 Register
 of Play
 Inspectors
 International
 rprii



✘ 25 - Very High Risk	
<p>Item: Activity Equipment - Monkey Bars Manufacturer: Owner/Operator Surface Type: Bark Mulch Equipment Compliance: N/A Surface Area Compliance: N/A Ref/Part Number:</p>	
<p>Finding 1 The timber on this item has severe rot - Remove and replace all affected timber sections</p>	<p>Finding 2 There is some evidence of rot in the timber - Monitor for any further deterioration and replace as required</p>

✘ 18 - High Risk (Finding 4)	
<p>Item: Activity Equipment - Multi Play (Junior) Manufacturer:</p>	<p>Risk Level: H - High Risk Surface: Wet Pour</p>
	
<p>Finding: The chain links are worn in excess of 40% and require renewing</p>	<p>Action: Replace worn chains</p>

 +44 (0) 1354 638193

 parts@onlineplaygrounds.co.uk

 onlineplaygrounds.co.uk

Spare Parts

We keep a wide range of original, regularly replaced parts in stock from most major manufacturers. So whether you are looking for Wicksteed, Kompan, Sutcliffe or Huck you can find them all in one place on our website:



 onlineplaygrounds.co.uk/commercial-spares



Refurbishment

Here at OLP we can repair, refurbish or replace your broken playground equipment. Whether it is rotten timbers, damaged steel, frayed nets or worn-out HDPE we can help by either carrying out the refurbishment ourselves or sending the parts for your in house team to fit.



BEFORE



AFTER



BEFORE



AFTER

 +44 (0) 1354 638193

 parts@onlineplaygrounds.co.uk


 onlineplaygrounds.co.uk



Replacement Nets & Ropes

We also repair and manufacture replacement nets and ropes, so whether you are looking for a climbing net, Burma Bridge or simple rope we can help.

These 16mm steel core ropes come in a variety of colours and meet standard EN 1176. They can either be replaced by our maintenance team or supplied complete with fixings for your own team to install.

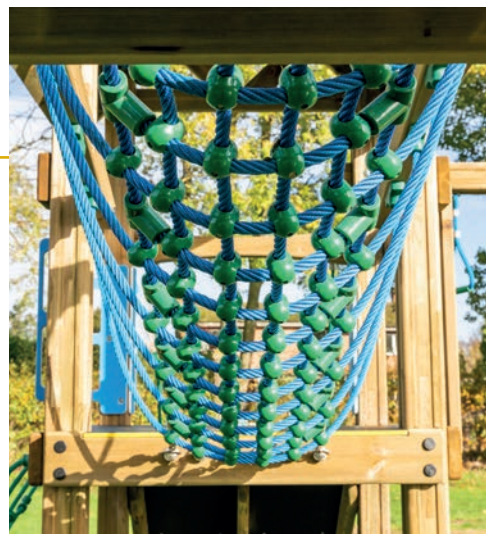

Gates

Gates are vitally important in any play area to keep children safe. We can source any part required to maintain your gates, or if for any reason they are beyond economical repair we can supply or install new ones for you.



 +44 (0) 1354 638193

 parts@onlineplaygrounds.co.uk

 onlineplaygrounds.co.uk



Surfacing

From Wetpour, Rubber Mulch and Safagrass to Artificial Grass, Bark and Sand there isn't a surface we can't lay or repair! Using premium grade products, we can give your outdoor space the safety surface it requires based on the critical fall heights of the equipment installed.

One of the most common problems is unsightly and dangerous gaps around the edge of wetpour caused by the rubber contracting over time. Our team can cut back and replace this to eliminate trip hazards and bring it back up to scratch.

Case Study GOREFIELD PLAYGROUND



Following an inspection our maintenance team swung into action over a very hot week to give this playground a £30,000 face lift. We repaired various pieces of equipment, refurbished roundabouts and swings, replaced ropes and shackles, resurfaced with both wetpour and fibre fall and replaced a timber that had been strimmed.

 +44 (0) 1354 638193


 parts@onlineplaygrounds.co.uk

 onlineplaygrounds.co.uk

OLP

online playgrounds

For spare parts why not visit our website
www.onlineplaygrounds.co.uk

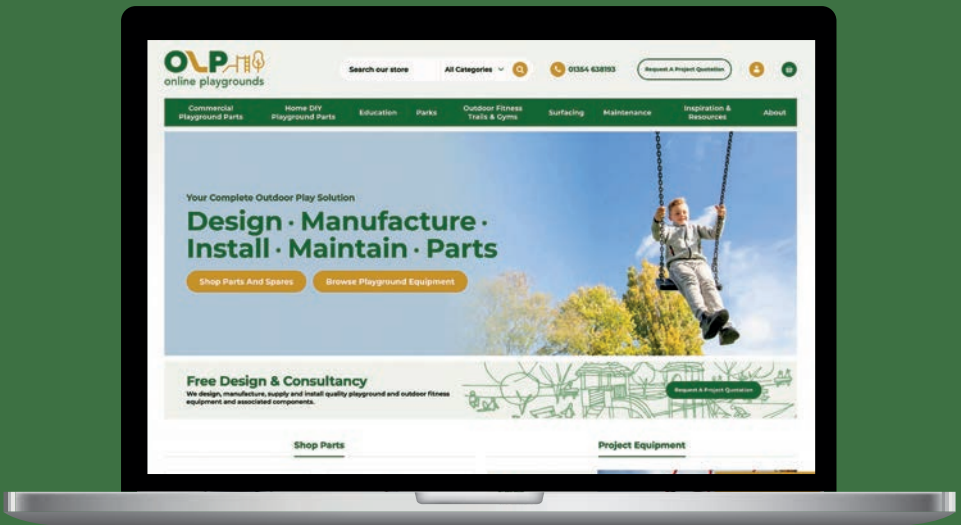

Contact our parts support team by telephone or email:

+44 (0) 1354 638193

parts@onlineplaygrounds.co.uk

onlineplaygrounds.co.uk



From: [Kirsty Masland - GB Sport](#)
To: [Hilary Workman](#)
Subject: Maintenance PARTS AND NOTES ONLY
Date: 23 February 2024 13:23:37
Attachments: [image001.png](#)
[image002.png](#)
[image003.png](#)
[image004.png](#)
[Maintenance Training.pdf](#)
[Annual Training.pdf](#)

Hello Hilary, thank you for your telephone call.

Please see a list of spares based on our conversation and reports sent. As discussed I do need to consult with our Technical Manager and Inspector Colin, I can ask him to give you a call to discuss the works required, I am working from home today but I can certainly call the office if you think this would help?

As discussed we offer a number of maintenance and training courses which your team might find beneficial, I have attached further information which I hope helps, I have also attached information on Wet & Forget – biodegradable mould and algae remover.

Biodegradable Moss, Mould, Lichen and Algae Remover

Wet & Forget has a unique combination of biodegradable selective surfactants for moss removal, mould removal and gunge removal on any exterior surface. When diluted with water and applied, it immediately attacks that unsightly moss, mould, gunge and grime. Each time it rains, this safe, cleansing combination reactivates to help flush the moss, mould, gunge and grime without scouring the surface it has infested.

- Non caustic
- Non acidic
- No bleach
- No pressure washing
- No elbow grease
- No special equipment
- Unlimited Shelf Life
- Covers 100m²-300m² depending on porosity of the surfaces

5 parts water : 1 part Wet & Forget

An average 5 litre concentrate cleans 100-300sq.m. depending on porosity of surface

Astro Turf on a Tennis Court takes 4 x 5 litre (ratio 3:1)

The treated surface requires no scrubbing or rinsing although badly contaminated surfaces may require brushing.

Important: You cannot use regular Wet & Forget 5L (blue) with the Rapid Application Sniper Nozzle. (It's just not the same!)

For 5 litre Pressure Spray see SP-35-018



BURY ROAD

Swing:

SP-03-079	Shackles @ £11.50	x 4	£46.00
SP-03-067a	Bushes @ £6.65	x 4	£26.60
SP-02-071	One Size Cradle Seat Chains @ £45.95 <i>Suitable for crossbars up to 3.0m high</i>	x 1	£45.95
SP-02-023	Varilinks – for above chains @ £7.15	x 2	£14.30
SP-02-070	One Size Flat Seat Chains @ £53.85 <i>Suitable for crossbars up to 3.0m high</i>	x 1	£53.85
SP-02-023	Varilinks – for above Chains @ £7.15	x 2	£14.30
SP-01-061	Curve Cradle Seat @£82.50	x 1	£82.50
SP-01-054a	Curve Large Flat Seat @ £37.00	x 1	£37.00

Jeep:

We supply a range of Lead Free, Quick Drying Paint, Primer and Thinners

Paint



SP-10-001	Quick Air Drying Lead Free Paint – 2.5 litres
SP-10-002	Quick Air Drying Lead Free Paint – 5 litres
SP-10-012	Zinc Phosphate Lead Free Primer – 2.5 litres
SP-10-003	Zinc Phosphate Lead Free Primer – 5 litres
SP-10-013	Wood Lead Free Primer – 2.5 litres
SP-10-009	Wood Lead Free Primer – 5 litres
SP-10-004a	Thinners – 2.5 litres
SP-10-004	Thinners – 5 litres
SP-10-005	Anti Slip Paint – 2.5 litres
SP-10-006	Anti Slip Paint – 5 litres
SP-107-002	Robinia Oil - .2.5 litres
SP-43-027	Pack 5 Disposable Paint Brushes
SP-35-011	Brush Renew
SP-10-015A	Anti Climb Paint – 5 litre – Black
SP-10-016	Warning Anti Climb Paint Sign 150mm x 200mm x 1mm Rigid Plastic

Multiplay Unit:

We offer a collect and replace service, we would collect the original net and return to our warehouse for use as a template, we would manufacture a new net and deliver for your installation.

Gate:

We offer a gate maintenance training course, details attached

SP-12-060	Complete Gate Repair Kit @ £115.00	x 1	£115.00
-----------	------------------------------------	-----	---------

Chain Link Fence: Information to follow

Activity Unit:

SP-35-017	5 litre Wet & Forget @ £32.10	x 1	£32.10
SP-35-018	5 litre Pressure Sprayer @25.00	x 1	£25.00

POCKET PARK 1:

More site information required

We offer a range of Litter Bins – please provide sized required

Basketball:

SP-14-023a	Heavy Duty Basketball Ring & Net Set @ £89.00	x 1	£89.00
------------	---	-----	--------

SKATE PARK:

More site information required

We offer a range of Litter Bins – please provide size required

Quarter Pipe:

6mm Skatelite Pro Boards available – installation would be required

Surface:

SP-35-017	5 litre Wet & Forget @ £32.10	x 1	£32.10
SP-35-018	5 litre Pressure Sprayer @25.00	x 1	£25.00

COMMUNITY CENTRE:

More site information required

We offer a range of Litter Bins – please provide size required

Swing:

SP-11-040	Grass Mats 1.5m x 1.0m x 23mm @ £22.00 each		
SP-11-041	Grass Mat Pegs – pack 100 @ £18.50		
SP-11-045	Grass Mat Ties – pack 100 @ £4.00		
SP-02-070	One Size Cradle Seat Chains @ £45.95 <i>Suitable for crossbars up to 3.0m high</i>	x 2	£45.95
SP-02-023	Varilinks – for above chains @ £7.15 Subject to discussion with Colin	x 4	£28.60
SP-35-017	5 litre Wet & Forget @ £32.10	x 1	£32.10
SP-35-018	5 litre Pressure Sprayer @25.00	x 1	£25.00

Birds Nest Seat & Chains – please specify size required



SP-01-052	Huck Original Basket Seat
SP-01-053	Huck Original Mini Basket Seat
SP-01-018a	1.0m Birds Nest Seat Rosette – A Frame*
SP-01-014a	1.2m Birds Nest Seat Rosette– A Frame *
SP-01-024	1.0m Birds Nest Seat – Cantilever*
SP-01-025	1.2m Birds Nest Seat – Cantilever*
SP-03-040	Bushes for Birds Nest Seat – Rosette – New Style
SP-05-020a	Birds Nest Seat Safety Chain

*suitable for 2.4m high crossbar

Stepping Posts:

SP-35-017	5 litre Wet & Forget @ £32.10	x 1	£32.10
SP-35-018	5 litre Pressure Sprayer @25.00	x 1	£25.00

Activity Trail:

We offer a collect and replace service, we would collect the original net and return to our warehouse for use as a template, we would manufacture a new net and deliver for your installation.

Multiplay Unit:

SP-11-040	Grass Mats 1.5m x 1.0m x 23mm @ £22.00 each		
SP-11-041	Grass Mat Pegs – pack 100 @ £18.50		
SP-11-045	Grass Mat Ties – pack 100 @ £4.00		
SP-35-017	5 litre Wet & Forget @ £32.10	x 1	£32.10
SP-35-018	5 litre Pressure Sprayer @25.00	x 1	£25.00

Aerial Runway:

We offer a Aerial Runway Maintenance Course, we also provide an inspection/dismantle and service, further details attached.



SP-05-034	Curve Pendulum Seat, Chain & Sleeve @ £38.00	x 1	£38.00
SP-05-025	Nylon Wheel @ £25.00	x 1	£25.00
SP-05-023	Jockey @ £180.00	x 1	£180.00
	c/w Safety Chain & Playlock Washer - includes Safety Chain Fitting Guide		

Gate:

SP-11-040	Grass Mats 1.5m x 1.0m x 23mm @ £22.00 each		
SP-11-041	Grass Mat Pegs – pack 100 @ £18.50		
SP-11-045	Grass Mat Ties – pack 100 @ £4.00		

Litter Bin:

We supply a range of Lead Free, Quick Drying Paint, Primer and Thinners

Paint	
	SP-10-001 Quick Air Drying Lead Free Paint – 2.5 litres
	SP-10-002 Quick Air Drying Lead Free Paint – 5 litres
	SP-10-012 Zin Phosphate Lead Free Primer – 2.5 litres
	SP-10-003 Zinc Phosphate Lead Free Primer – 5 litres
	SP-10-013 Wood Lead Free Primer – 2.5 litres
	SP-10-009 Wood Lead Free Primer – 5 litres
	SP-10-004a Thinners – 2.5 litres
	SP-10-004 Thinners – 5 litres
	SP-10-005 Anti Slip Paint – 2.5 litres
	SP-10-006 Anti Slip Paint – 5 litres
	SP-107-002 Robinia Oil - 2.5 litres
	SP-43-027 Pack 5 Disposable Paint Brushes
	SP-35-011 Brush Renew
	SP-10-015A Anti Climb Paint – 5 litre – Black
	SP-10-016 Warning Anti Climb Paint Sign 150mm x 200mm x 1mm Rigid Plastic

Notes and prices are guidance only, supply only and subject to delivery and VAT

I hope the above helps and if you would like Colin to contact you to discuss further please let me know.

Best wishes

Kirsty

Kirsty Masland

Marketing Director & Midlands Sales Manager

01934 628620

gbsportandleisure.co.uk



Sport · Play · Surfacing · StreetScene · Maintenance

The information in this email is confidential. It is intended solely for the addressee. Opinions expressed are those of the individual and do not necessarily represent the opinion of G.B. Sport & Leisure.
Company reg 7524691 Country of incorporation United Kingdom. Registered office:
Fresford House, Rodcliffe Way, Bristol, BS31 6NL



[Click here to view our brochure](#)

Annual Training Course

Proposal for 4x training courses to be carried out over a 12 month period comprising of:

- Wet Pour Demonstration Day
- Gate Training
- Maintenance Day
- Aerial Runway Training

Wet Pour Demonstration Day – held at a play area of your choice –

- A wet pour repair of up to 2m² in black rubber will be demonstrated at a nearby site of your choice
- Candidates carry out hands-on training during the repair
- We provide all the materials and tools required
- Candidates receive a leaflet and talk through all aspects of wet pour repair
- A classroom session will take place to include a question and answers session
- Certificate of attendance will be given to all candidates



Gate Maintenance Training Day – we provide in-depth training with practical demonstration -

- We are the only approved IAE Prosafe Engineers Training Centre in the UK
- Gain knowledge on the different gate systems available
- Learn about the standards required to remain compliant
- How to check gates and correctly identify and report hazards
- Troubleshooting/fault finding exercises with practical demonstrations for excellence in gate maintenance and safety
- Gate installation information
- Part codes and product knowledge



GB SPORT & LEISURE

Maintenance Demonstration Day – Health & Safety is our No.1 Priority

- This course would ideally suit those operatives that undertake installation and maintenance works of children's play equipment
- EN1176 safety standards relating to installation and maintenance
- Practical issues relating to the site conditions and products used
- Implications relating to poorly installed and maintained equipment
- Health & Safety
- Development of "Good Working practices
- Can be tailored to suit your requirements



Aerial Runway – Onsite training

- Onsite training
- How to remove a cable safely
- How to tension the cable
- How to service the Jockey and Brake Spring Mechanism
- Health & Safety



Any additional parts used will be chargeable



**Playground
Maintenance
Specialists**



Wet Pour Demonstration

Held at a play area of your choice

- A wet pour repair of up to 2m² in black rubber will be demonstrated at a nearby site of your choice.
- Candidates carry out hands-on training during the repair.
- We provide all materials and tools required
- Candidates receive a leaflet and talk through all aspects of wet pour repair.
- A classroom session will take place to include a question and answers session
- Certificate of attendance will be given to all candidates

Gate Maintenance Training

We provide in-depth training with practical demonstrations.

- Gain knowledge on the different gate systems available.
- Learn about the standards required, to remain compliant.
- How to check gates and correctly identify and report hazards.
- Troubleshooting/fault finding exercises, with practical demonstrations for excellence in gate maintenance and safety.
- Gate installation information.
- Part codes and product knowledge.

We are the only approved IAE Prosafe Engineers Training Centre in the UK.





Why use GB Sport & Leisure?

Here at GB Sport & Leisure, we offer a one-stop-shop nationally, for all of your play and sport requirements.

Our dedicated team has in excess of 100 years combined experience and are specialists in responding to your inquiries & needs. Recognised as a leader and trusted partner in the industry, we work closely with local authorities, parish councils, schools, sports clubs, and the private sector.

We offer a complete range of after-sales care including spare parts, repair kits, consumables, safety inspections. As well as a wide range of recreational equipment from playgrounds, outdoor gyms, multi-use games areas (MUGA's), skate parks, youth shelters, to include supply and installation of surfacing, fencing, and gates.



CONTACT US

01934 628 620

sales@gbsportandleisure.co.uk


Maintenance Training

Health & Safety is our No.1 Priority

This course would ideally suit those operatives that undertake installation and maintenance works of children's play equipment.

- EN1176 safety standards relating to installation and maintenance.
- Practical issues relating to the site conditions and products used.
- Implications relating to poorly installed and maintained equipment.
- Health & Safety
- Development of "Good Working" practices

Maintenance Matters:

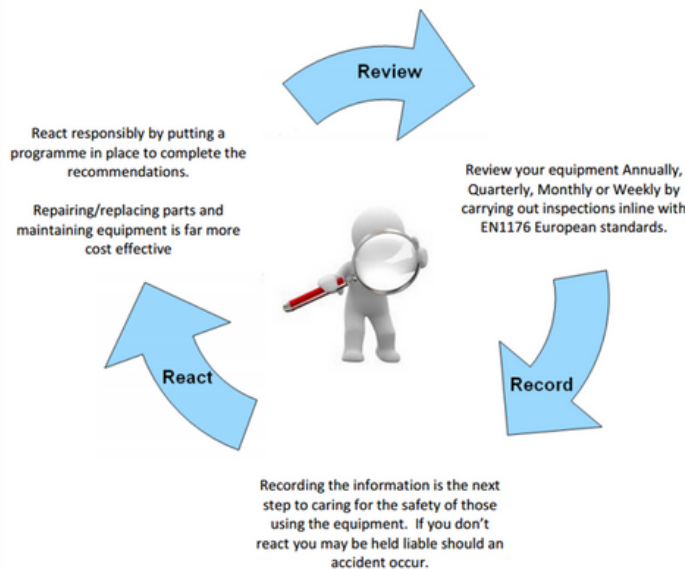

GB Sport & Leisure UK Ltd
 Unit 7 Oakwood Business Park
 Old Mixon Crescent
 Weston-super-Mare
 BS24 9AY

WWW.GBSPORTANDLEISURE.CO.UK

Company reg. 07524601



Full Quote

Product Image	Product	Qty
Bury Road - Gate - Review & Adjustment		
Current FY	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177.	1
Subtotal		£70.00

Product Image	Product	Qty
Bury Road - Bay Mount Seat - Fixings 2,3,4 & 5		
Current FY	SW15-126C - Round / Subtitle / Playable Shackles / Bolt 12mm X 26mm X 50mm	4
Current FY	SW11 Playable Dibs Bush - F400 12 X 22 X 16mm ID X OD X Length	4
Current FY	SW10C - 6mm Stainless Steel	1
Current FY	straight swing chairs per pair for cradle seats.	1
Current FY	Sw22 - Premium Cradle Swing Seat	1
2025C	To breakout existing post and foundation, prepare foundation hole and re-concrete. - 500mm	4
Next FY	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177.	4
2025B	120mm to 160mm Diameter Post Foot Foundation including M12 x 160mm stainless steel coachbolt, washer nylon and two part epox.	4
Subtotal		£1,565.20

Product Image	Product	Qty
Bury Road - Multi Play - Replacement Rope - attached to existing fixings		
Current FY	Single 16mm steelcore combination ropes complete with two end fittings. Length - ***** End Fitting *****	1
Current FY	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177.	1
Subtotal		£123.70

Product Image	Product	Qty
Skate Park - Shelter & Half Pipe		
Current FY	Flange Top Shovel Fixing 16mm Thread 4 x 20mm in Stainless Steel with serrated nibs.	35
Current FY	Wear Deck including bolts, nuts, washers and protection caps.	1
Current FY	To sand and minor tightening of fixings or sanding on an item of playground or fitness equipment.	1
Subtotal		£51.25

Product Image	Product	Qty
Wickhambrook - Springers x 2		
Grant Application	Concrete services beyond economical repair.	2
Grant Application	To breakout existing post and foundation, prepare foundation hole and re-concrete. - 500mm	2
Grant Application	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177.	2
Grant Application	Willy Whale Sit In Spring Rocker produced in low maintenance HDPE with a set of ground anchors. TÜV certified to EN1176. Suitable for ages range 1 to 4.	1
Grant Application	Product assembly and installation into a soft dig with good access including concrete foundations.	1
Grant Application	Motorbike & Sidecar Spring Rocker produced in low maintenance HDPE with a set of ground anchors. TÜV certified to EN1176. Suitable for age range 1 to 6.	1
Grant Application	Product assembly and installation into a soft dig with good access including concrete foundations.	1
Subtotal		£3,154.00

Product Image	Product	Qty
Wickhambrook - 1 Bay 2 Seat Cradle		
Current FY	SW10C - 6mm Stainless Steel	2
Current FY	straight swing chairs per pair for cradle seats.	2
Current FY	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177.	2
Subtotal		£488.00

Product Image	Product	Qty
Activity Trail - bolt caps, nets, sanding & tightening of bolts		
Next FY	F13 - 36mm Round Insert Cap - BK (Bolt holes between 28 - 32mm) - This cap used in OLP Production!	2
Next FY	Carps Access Net manufactured from 16mm steelcore combination rope with fixings on top and both sides. Size A ***** Size B ***** 1120 x 1600mm	1
Next FY	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177.	2
Next FY	To sand and minor tightening of fixings or sanding on an item of playground or fitness equipment.	1.5
Subtotal		£508.80

Product Image	Product	Qty
2 Bay 2 Row & 1 Bay Seat		
Current FY	Sw19 - Large Swivel Seat	2
Current FY	SWC4.3 0F - Straight Flat Seat (Chain seat)	2
Next FY	Sw25.2 - 1M Birds Nest Swivel Seat in Blue / Red Rope With 2 Point Suspension	1
Next FY	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177.	3.5
Subtotal		£1,016.00

Product Image	Product	Qty
Multi Play - Manual - Investigation of sliding handle		
Next FY	P16 - Multigrades Lubricants Oil - 100ml	1
Subtotal		£2.50

Product Image	Product	Qty
Cableway - seat inspection/fixing & adding nylon inserts - Full inspection certificate will be provided		
Next FY	AC3B Finer Protection Guard For R & T Stainless Cableway Trolley (acid per part)	2
Next FY	AC2 - Subtitle Pendulum Seat	1
Next FY	SW16 replacement swing hanger bolt for SW5 / SW20 / SW21 swing hanger bolt assemblies - 16 x 30mm including nylon locknut nut.	1
Next FY	***BOLT TO FIX SEAT TO CABLEWAY*** Aerial Cableway Service/Re-tension and commission including access equipment (working at heights HSE - regulation 2005) excluding travel to site. ***HAVE TO DROP CABLEWAY TO FIT NYLON INSERTS***	1
Subtotal		£556.50

Total (inc. vat)	£8,065.96
Vat	
Total (inc. vat)	

	Bury Road	Cametery Road	Skate Park	Total
Current FY	£270.90	£348.00	£10.00	£628.90
Next FY	£420.00	£1,530.00	£41.25	£1,991.25
2025/26	£1,565.20	£2,290.80		£3,856.00
Grant Application		£3,826.00		£3,826.00
Total	£2,256.10	£5,004.80	£51.25	£7,312.15

Current FY

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Bury Road - Bay Mixed Seat - Findings 2,3,4 & 5					
	COMSWISHA0011	SW15-12REC - Record / Sutcliffe / Playdale Shackle / Bolt 12mm X 26mm X 50mm	4	£4.10	£16.40
	COMSWIOIL0020	SW11 Playdale Oilite Bush - F400 12 x 22 x 16mm I/D x O/D x Length	4	£6.70	£26.80
	SUBSWISTR6M001C	SWC10C - 6mm Stainless Steel straight swing chains per pair for cradle seats.	1	£72.00	£72.00
	COMSWISEA0004	Sw22 - Premium Cradle Swing Seat	1	£102.00	£102.00

Subtotal £217.20

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Bury Road - Multi Play - Replacement Rope - attached to existing fixings					
	WEBCLIROP	Single 16mm steelcore combination ropes complete with two end fittings. Length - ***** Colour - ***** End Fitting - *****	1	£53.70	£53.70

Subtotal £53.70

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Skate Park - Shelter & Half Pipe					
	COMHARMIS0004	Misc Bolt Pack including bolts, nuts, washers and protection caps.	1	£10.00	£10.00

Subtotal £10.00

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Wickhambrook - 1 Bay 2 Seat Cradle					
	SUBSWISTR6M001C	SWC10C - 6mm Stainless Steel straight swing chains per pair for cradle seats.	2	£72.00	£144.00
	COMSWISEA0004	Sw22 - Premium Cradle Swing Seat	2	£102.00	£204.00

Subtotal £348.00

Total (ex. tax)	£628.90
Tax	£125.78
Total (inc. tax)	£754.68

Bury Road	£270.90
Skate Park	£10.00
Cemetery Road	£348.00
	£628.90

2024 -25

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Bury Road - Gate - Review & Adjustment					
	PRELIM-04	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177	1	£70.00	£70.00
Subtotal					£70.00

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Bury Road - Bay Mixed Seat - Findings 2,3,4 & 5					
	PRELIM-04	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177	4	£70.00	£280.00
Subtotal					£280.00

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Bury Road - Multi Play - Replacement Rope - attached to existing fixings					
	PRELIM-04	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177	1	£70.00	£70.00
Subtotal					£70.00

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Skate Park - Shelter & Half Pipe					
	COMHARNAI0025	Flange Pop Rivets Fixing 16mm Head 4.8 x 20mm in Stainless Steel with serrated edges.	25	£0.37	£9.25
	DESLAINS010	To carryout minor tightening of fixings or sanding on an item of playground or fitness equipment.	1	£32.00	£32.00
Subtotal					£41.25

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Wickhambrook - 1 Bay 2 Seat Cradle					
	PRELIM-04	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177	2	£70.00	£140.00
Subtotal					£140.00

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Multi-Play - Monorail - Investigation of sliding handle					
		We will check monorail when on site - as this was repaired in September, possible inspector error	1	£0.00	£0.00
	DESLAINS010	To carryout minor tightening of fixings or sanding on an item of playground or fitness equipment.	1	£32.00	£32.00
	COMCOA009	P16 - Multipurpose Lubricating Oil - 100ml	1	£2.50	£2.50
Subtotal					£34.50

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Climbing Frame - Investigate, disassemble and advise corrective action					
	ASSESSM-1	Playground maintenance assessment to EN1176 / EN1177 complete with quotation. This charge will be refunded from quotes ordered over £950 + VAT.	1	£175.00	£175.00
Subtotal					£175.00

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Cableway - seat inspection/fixing & adding nylon inserts - Full Inspection certificate will be provided					
	COMCAB0009	AC3B Finger Protection Guard For R & T Stainless Cableway Trolley (sold per pair)	2	£12.00	£24.00
	COMCAB0005	AC3 - Sutcliffe Pendulum Seat	1	£90.00	£90.00
	COMSWIHANM8X30	SW84A replacement swing hanger bolt for SW5 / SW29 / SW81 swing hanger bolt assemblies - M8 x 30mm including nyloc locking nut.	1	£2.50	£2.50
	DESLAINS006	**BOLT TO FIX SEAT TO CABLEWAY** Aerial Cableway Service/re-tension and commission including access equipment (working at heights HSE - regulation 2005) excluding travel to site. **HAVE TO DROP CABLEWAY TO FIT NYLON INSERTS**	1	£440.00	£440.00
Subtotal					£556.50

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Preliminaries & Travel (2trips)					
	PRELIM-03	To travel to site with up to 3 staff members per vehicle including mileage cost.	180	£1.90	£342.00
	PRELIM-05	To prepare maintenance works risk assessments and method statements covering playground repairs works.	1	£30.00	£30.00
	PRELIM-13	To hire, erect and remove fencing per panel including blocks, feet and clips - per panel. (3.5m)	6	£20.00	£120.00
	PRELIM-08	Environmental removal of general waste from site. All waste to be transferred to a registered recycling centre for further processing.	0.5	£280.00	£140.00
Subtotal					£632.00

	Bury Road	Skate Park Cemetery Road	Total
Total (ex. tax)	£1,999.25	£420.00	£1,538.00
Tax	£399.85		
Total (inc. tax)	£2,399.10		£1,999.25

2025 - 26

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Bury Road - Bay Mixed Seat - Findings 2,3,4 & 5					
	BASE36	To breakout existing post and foundation, prepare foundation hole and re-concrete. - Each	4	£207.00	£828.00
	PRELIM-04	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177	4	£70.00	£280.00
	SUBSTEMIS0009	140mm to 160mm Diameter Post Foot Foundation including M12 x 180mm stainless steel coachbolts, washer nyloc and two part cap.	4	£60.00	£240.00

Subtotal £1,565.20

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Activity Trail - bolt caps, nets, sanding & tightening of bolts					
	COMPLACAP0001	F13 - 34mm Round Insert Cap - BK (Suits holes between 28 - 32mm) ** This cap used in OLP Production*	2	£0.40	£0.80
	WEBCARNET	Cargo Access Net manufactured from 16mm steelcore combination rope with fixings on top and both sides. Side A: **** Side B ***** Colour: ***** Fixing Type: **** 1325 x 1650mm	1	£750.00	£750.00
	PRELIM-04	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177	2	£70.00	£140.00
	DESLAINS010	To carryout minor tightening of fixings or sanding on an item of playground or fitness equipment	1.5	£32.00	£48.00

Subtotal £938.80

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
2 bay 2 flat & 1 basket seat					
	COMSWISEA0007	Sw25.2 - 1M Birds Nest Swing Seat In Blue / Red Rope With 2 Point Suspension	1	£575.00	£575.00
	PRELIM-04	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177	3.5	£70.00	£245.00

Subtotal £820.00

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Preliminaries & Travel (2trips)					
	PRELIM-03	To travel to site with up to 3 staff members per vehicle including mileage cost.	180	£1.90	£342.00
	PRELIM-05	To prepare maintenance works risk assessments and method statements covering playground repairs works.	1	£30.00	£30.00
	PRELIM-13	To hire, erect and remove fencing per panel including blocks, feet and clips - per panel. (3.5m)	6	£20.00	£120.00
	PRELIM-08	Environmental removal of general waste from site. All waste to be transferred to a registered recycling centre for further processing.	0.5	£280.00	£140.00

Subtotal £632.00

Total (ex. tax)	£3,956.00
Tax	£791.20
Total (inc. tax)	£4,747.20

Bury Rd	Skate Park	Cemetery Rd	Total
£1,565.20		£2,390.80	£3,956.00

To be funded by Grant

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Wickhambrook - Springs x 2					
		Existing springs beyond economical repair	2	£0.00	£0.00
	BASE36	To breakout existing post and foundation, prepare foundation hole and re-concrete. - Each	2	£207.00	£414.00
	PRELIM-04	To carry out maintenance work and fit parts as described above including all consumables. All work carried out to EN1176 and EN1177	2	£70.00	£140.00
	MSPA05	Willy Whale Sit In Spring Rocker produced in low maintenance HDPE with a set of ground anchors. TUV certified to EN1176. Suitable for age range 1 to 4.	1	£740.00	£740.00
	PRO-INST-4	Product assembly and installation into a soft dig with good access including concrete foundations	1	£225.00	£225.00
	MSPA11	Motorbike & Sidecar Spring Rocker produced in low maintenance HDPE with a set of ground anchors. TUV certified to EN1176. Suitable for age range 1 to 6.	1	£1,360.00	£1,360.00
	PRO-INST-6	Product assembly and installation into a soft dig with good access including concrete foundations	1	£315.00	£315.00

Subtotal £3,194.00

Product Image	SKU Code	Product	Qty	Each GBP	Total GBP
Preliminaries & Travel (2trips)					
	PRELIM-03	To travel to site with up to 3 staff members per vehicle including mileage cost.	180	£1.90	£342.00
	PRELIM-05	To prepare maintenance works risk assessments and method statements covering playground repairs works.	1	£30.00	£30.00
	PRELIM-13	To hire, erect and remove fencing per panel including blocks, feet and clips - per panel. (3.5m)	6	£20.00	£120.00
	PRELIM-08	Environmental removal of general waste from site. All waste to be transferred to a registered recycling centre for further processing.	0.5	£280.00	£140.00

Subtotal £632.00

Total (ex. tax)	£3,826.00
Tax	£765.20
Total (inc. tax)	£4,591.20